

Hubbell Premise Wiring Instruction Sheet HJU Series UTP Jack Termination Instructions


ontroi No. HWS77203601

Date: 4/13/20

Place wire manager on cable. (Figure 1) Remove 1" (25mm) of jacket from cable. (Figure 2)



Note: Accepts 24 to 22 AWG conductors. Max cable diameter .31" (8mm).

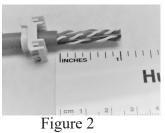

Trim wire separator from cable and insert wires into the slots in the wire manager based on the desired color code. (T568A/T568B) (Figure 3)

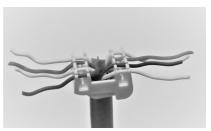


Figure 3


3



Trim wires flush to wire manager. The wires should not protrude more than 1/64" (.5mm) from wire manager. (Figure 4)

Figure 4

Line up arrows on wire manager with arrows on jack. Note: The brown pair will always go towards the Cobra Lock. (Figure 5)

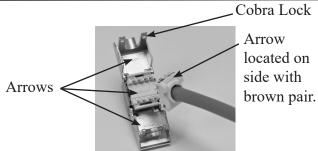

Arrow located on side with

Figure 5

With wire manager in place, rotate termination jaws; the jaw opposite the Cobra Lock should rotate first. (Figure 6)



D.HWS77203601

Date: 4/13/20

Figure 6

Squeaze the termination jaws closed until the Cobra Lock latches engage to complete the termination. (Figures 7, 8)

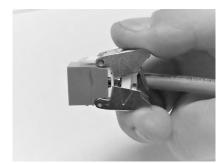


Figure 7

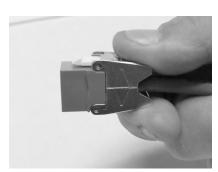


Figure 8

6

To disassemble the jack, place a small flat screw driver into the slots and rotate to pry open the Cobra Lock latches. (Figure 9)



Figure 9

Hubbell Premise Wiring, HUBBELL INCORPORATED (Delaware) 23 Clara Dr Suite 103 Mystic, CT 06355 (800) 626-0005, Fax (860) 535-8328 www.hubbell-premise.com