






 
 
Troubleshooting Your New Door Holder

**NORTON
RIXSON**


ASSA ABLOY

PROBLEM


- Does not hold

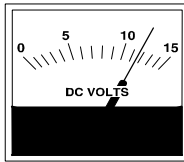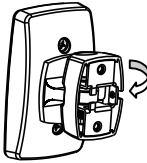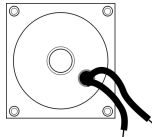

 - Holding force weak (less than 25 pounds)



- Humming sound

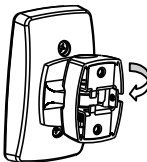

POSSIBLE CAUSE

Power not turned on.

Neutral wire not connected to "COM" on terminal strip.

Power wire not connected to correct power slot on terminal strip.

For single voltage coils--one wire attaches to ground, the other is attached to the power wire.

Contact plate is not sitting completely flat across circular ring of the coil.

Check line voltage coming from power supply (range +/-10%).

For DC coils reverse polarity. Switch position of wires on terminal strip.

Dirt or cleaning solvent on contact plate or on circular ring of coil; **wipe with very fine emery cloth.**

Power wire not connected to correct power slot on terminal strip.

12VAC input instead of 12VDC

Contact plate not sitting completely flat across the circular ring of the coil.

Technical Product Support:
 Monroe, NC 28112 USA
 Phone: 800.438.1951 ext: 6030
 Techsupport.NortonRixson@assaabloy.com
 NortonRixson.com

Experience a safer
and more open world