 



Instruction Sheet


Legrand Installation, Unshielded Cat 6/ Cat 5E Field Termination Plugs

- Remove the cover stopper from plug housing assembly before installation.
- Strip off at least 1.5 inches of cable jacket. Remove any foil or spline from cable.

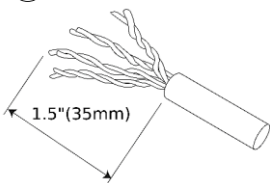


JACK PIN DESIGNATIONS	TIA / EIA T568A	TIA / EIA T568B	INDUSTRIAL
	1	White/Green	White/Orange
2	Green	Orange	Orange
3	White/Orange	White/Green	White
6	Orange	Green	Blue
4	Blue	Blue	
5	White/Blue	White/Blue	
7	White/Brown	White/Brown	
8	Brown	Brown	


- Fan out all four twisted pairs. With the attached wiring cap label facing up, insert the bottom row of conductors according to the indicated color code. Push the wiring cap back to the cable jacket and trim bottom conductors flush to cap end. Place the remaining conductors into the top row of the wiring cap according to the indicated color code. Trim top conductors at location shown in illustration.

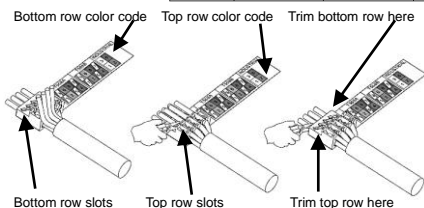


Rotate the conductor assembly into position with the wiring cap label facing down. Remove the wiring label from the cap and align the rear of the wiring cap with the opening pocket guides of the plug receptacle.

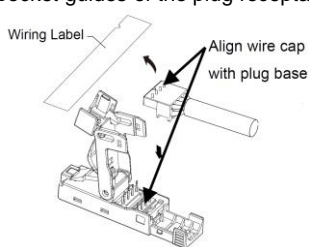

 
- Place the wiring cap onto plug, use plier to terminate wiring cap until fully pressed.



- Close plug cover, press strain relief until secure on cable.

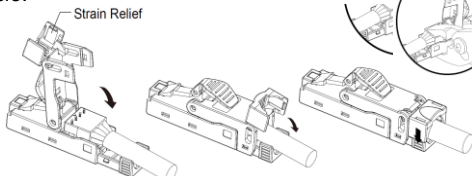

Unloading the cable: Using a flat screw driver, pry gently on one end of the plug cover first and the other end subsequently to open it.

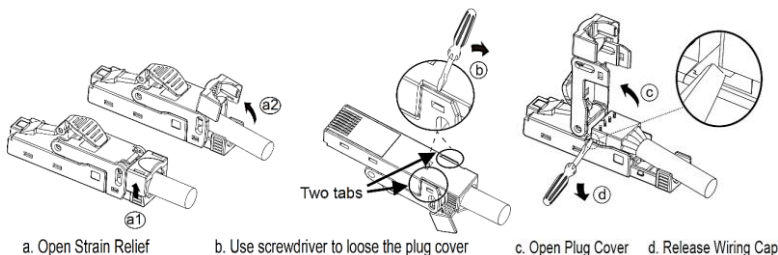

a. Open Strain Relief

b. Use screwdriver to loose the plug cover

c. Open Plug Cover d. Release Wiring Cap

71602029
Rev 00

For field testing guidance on all unshielded Field Term Plugs please download from website: Go to <http://www.legrand.us>, then enter HDPUC65E-5PK into the upper right search box.